

SHENANDOAH

CONSTRUCTION

1888 N.W. 22nd Street • Pompano Beach, FL 33069
(954) 975-0098 Fax: (954) 975-9718

CULVERT PIPE INSPECTION FORM

SITE # 130

DATE OF INSPECTION 11-19-13 TIME STARTED 0800 COMPLETED 1215

CUSTOMER'S NAME Village of Wellington DISTRICT _____

LOCATION OF PIPE In Polo Club

TYPE OF PIPE CMP DIAMETER 60" LENGTH 115'

DEPTH FROM SURFACE TO THE TOP OF THE PIPE Submerged



DESCRIBE ACCESS TO THE PIPE Threw outfall Near Tee box West

END OF PIPE INSPECTION MADE FROM (N. S. E. W.) West outfall to East Outfall

GENERAL CONDITION OF PIPE Pipe contained sand & shell mixture @ an average of 1d" the highest being 18" and lowest 7". 30' in from the east outfall the pipe is collapsed for almost 20'. See illustration on back

ILLUSTRATE CONDITION & CONTENTS OF PIPE

A. CROSS SECTION

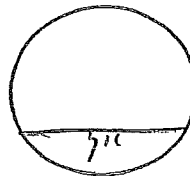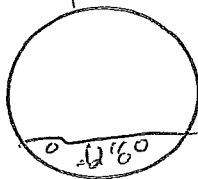

B. CULVERT APPROACH



C. CULVERT PROFILE (SEE BACK OF PAGE).

COMMENTS This pipe contained an average of 1d" of sand and needs cleaning. There is a 20' section of pipe towards the east outfall that has collapsed. Major repair or replacement may be necessary.





Crew Members: John B. Tark

NAME OF CUSTOMER'S REPRESENTATIVE ON SITE _____

*ILLUSTRATIONS NOT TO SCALE

Site # 130

C. Culvert Profile

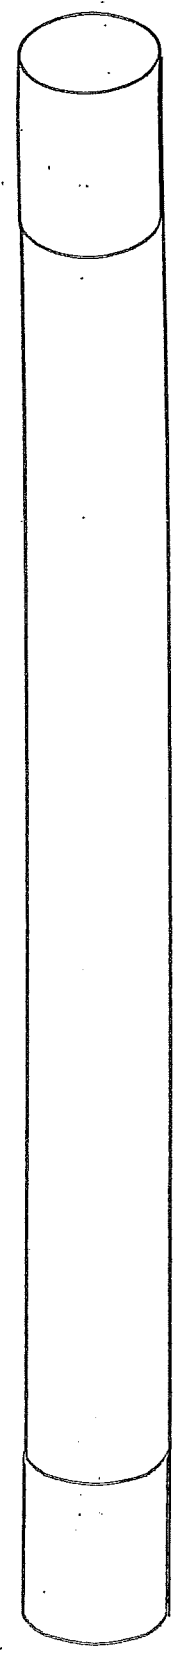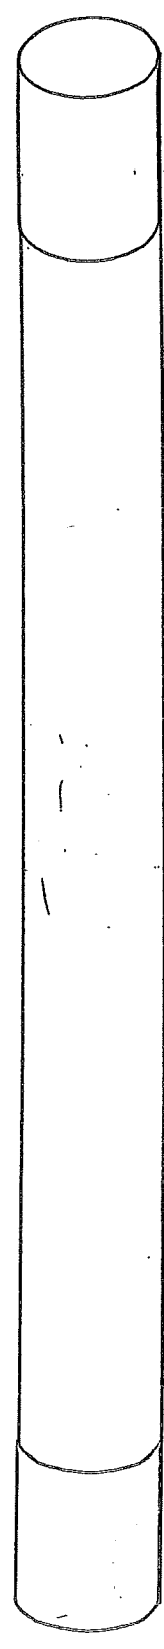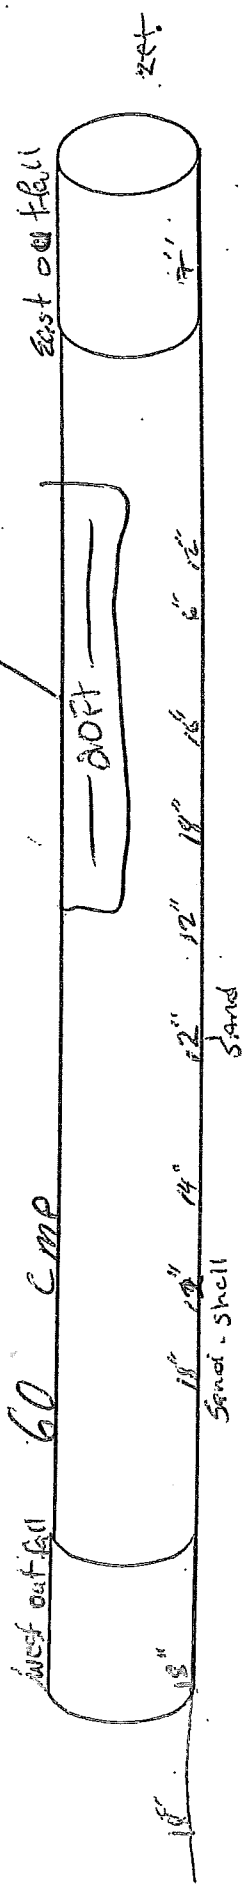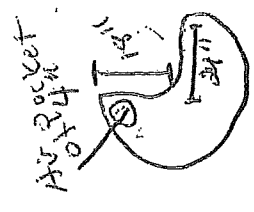

Notes: from 12 o'clock the pipe dent came in 18" ^{3000K} Aug-24 12/3

the sea like soft clay

from bottom were the dirt came down 33" were the

a wave the dirt if

910 800 3.51"